WHITE—DIVISION OF WATER RESOURCES
CANARY—CLIENT'S COPY
PINK—WELL DRILLER'S COPY

PRINT OR TYPE ONLY
DO NOT WRITE ON BACK

STATE OF NEVADA
DIVISION OF WATER RESOURCES

# WELL DRILLER'S REPORT

Please complete this form in its entirety in accordance with NRS 534.170 and NAC 534.340

OFFICE USE ONLY
Log No. 109680
Permit No.
Basin Ø9Ø pg 1 of 3

NOTICE OF INTENT NO. 60955

1. OWNER Chevron Env. Management Co.
MAILING ADDRESS 6001 Bollinger Cyn Rd San Ramon, CA 94583
ADDRESS AT WELL LOCATION 941 Tahoe BL Incline Village, NV 89451
Lat 39.249273 Long -119.947094 NAD 83

2. LOCATION NW ¼ ~~SE~~ ¼ Sec. 15 T. 16 N/S R. 18 E. Washoe County

PERMIT NO. 4-000061 (Issued by Water Resources) | 132-231-09 (Parcel No.) | Subdivision Name

3. WORK PERFORMED
☐ New Well ☐ Replace ☐ Recondition
☐ Deepen ☒ Abandon ☐ Other

4. PROPOSED USE
☐ Domestic ☐ Irrigation ☐ Test
☐ Municipal/Industrial ☒ Monitor ☐ Stock

5. WELL TYPE
☐ Cable ☐ Rotary ☐ RVC
☐ Air ☐ Other Sonic

6. LITHOLOGIC LOG

| Material | Water Strata | From | To | Thickness |
|---|---|---|---|---|
| Over Drill Well To 39.5, Remove Debris, Pump Grout from Bottom To Surface | | | | |
| Note Well no longer produced water, Abandon to Drill a Deeper well Next to MW-12 | | | | |

Date started 9-17, 2007
Date completed 9-17, 2007

7. WELL TEST DATA

TEST METHOD: ☐ Bailer ☐ Pump ☐ Air Lift

| | G.P.M. | Draw Down (Feet Below Static) | Time (Hours) |
|---|---|---|---|
| 39.249365°N | | AM 10:13 | 2007 OCT 22 |
| 119.946072°W | | | AM 10:14 |
| NAD 27 | | | |

8. WELL CONSTRUCTION
Depth Drilled 50 Feet Depth Cased 39 Feet

HOLE DIAMETER (BIT SIZE)

| | From | To |
|---|---|---|
| 8 Inches | 0 Feet | 39.5 Feet |
| Inches | Feet | Feet |
| Inches | Feet | Feet |

CASING SCHEDULE

| Size O.D. (Inches) | Weight/Ft. (Pounds) | Wall Thickness (Inches) | From (Feet) | To (Feet) |
|---|---|---|---|---|
| | | | | |

Perforations:
Type perforation
Size perforation
From feet to feet
From feet to feet
From feet to feet
From feet to feet
From feet to feet

Surface Seal: ☐ Yes ☐ No
Depth of Seal
Placement Method: ☒ Pumped ☐ Poured
Seal Type: ☐ Neat Cement ☒ Cement Grout ☐ Concrete Grout

Gravel Packed: ☐ Yes ☐ No
From feet to #NOI (60952) feet

9. WATER LEVEL no water in well See MW-12 R Re Instr
Static water level NA Dry feet below land surface
Artesian flow G.P.M. P.S.I.
Water temperature °F Quality

10. DRILLER'S CERTIFICATION
This well was drilled under my supervision and the report is true to the best of my knowledge.
Name Mario Romero / Boat longyear (Contractor)
Address 12464 McCann Dr (Contractor)
Santa Fe Springs, CA 90670
Nevada contractor's license number issued by the State Contractor's Board 0051765
Nevada driller's license number issued by the Division of Water Resources, the on-site driller M-2313
Signed [signature] By driller performing actual drilling on site or contractor
Date 10-12-07

(Rev. 12-01) USE ADDITIONAL SHEETS IF NECESSARY (O)-627

Log #109680 pg 2 of 3

| | |
|---|---|
| PROJECT: Former Chevron Service Station No. 9-4116<br>LOCATION: 947 Tahoe Boulevard, Incline Village, Nevada<br>PROJECT NUMBER: 77CH.94116.13.1112 | WELL / PROBEHOLE / BOREHOLE NO.<br>**MW-12** PAGE 1 OF 1<br>SECOR |
| DRILLING: STARTED 5/26/06 COMPLETED: 5/30/06<br>INSTALLATION: STARTED 5/26/06 COMPLETED: 5/30/06<br>DRILLING COMPANY: Cascade<br>DRILLING EQUIPMENT: Air Rotary<br>DRILLING METHOD: Open Hole Air Rotary<br>SAMPLING EQUIPMENT: Brass Sleeve | NORTHING (ft):<br>LATITUDE:<br>GROUND ELEV (ft):<br>INITIAL DTW (ft): 28 5/26/06<br>STATIC DTW (ft): 22 5/26/06<br>WELL CASING DIAMETER (in): 2<br>LOGGED BY: BM |
| | EASTING (ft):<br>LONGITUDE:<br>TOC ELEV (ft):<br>BOREHOLE DEPTH (ft): 50.0<br>WELL DEPTH (ft): 39.5<br>BOREHOLE DIAMETER (in): 8<br>CHECKED BY: |

| Time & Depth (feet) | Graphic Log | USCS | Description | Sample | Time Sample ID | Measured Recov. (feet) | Blow Count | Headspace PID (units) | Depth (feet) |
|---|---|---|---|---|---|---|---|---|---|
| | | | Hand cleared to 7' bgs | | | | | | |
| 5 | | | | | | | | | 5 |
| 0845 10 | | SM | SM; Medium to poorly graded sand with silt; loose; dry; no odor; 10YR 4/3; 60% sand, 40% silt; few organics | ■ | 0845 MW-12-S-10 060526 | 0.5 | | 7.3 ppm | 10 |
| 0905 15 | | SM | SM; Medium to well graded sand with silt; loose dry; no odor; no organics; 10YR 3/3; 80% sand, 20% silt | ■ | 0905 MW-12-S-15 060526 | 0.5 | | 1.2 ppm | 15 |
| 20 | | | Unable to collect sample | | | | | | 20 |
| 1010 25 | | SC | SC; Sandy silt; wet; 10YR 5/6; no odor | ■ | 1010 MW-12-S-25 060526 | 0.5 | | 1.7 ppm | 25 |
| 30 | | | Unable to collect sample | | | | | | 30 |
| 35 | | | Unable to collect sample | | | | | | 35 |
| 1139 40 | | SC | SC; Sandy silt; wet; no odor; 10YR 4/4; 20% sand, 80% silt | ■ | 1139 MW-12-S-40 060526 | 0.5 | | 0.7 ppm | 40 |
| 1215 45 | | SC | SC; Sandy silt; wet; no odor; no organics; 10YR 4/3; 20% sand, 80% silt | ■ | 1215 MW-12-S-45 060526 | 0.5 | | 0.2 ppm | 45 |
| 1515 50 | | | Hole terminated at 50 feet. | ■ | 1515 MW-12-S-50 060526 | 0.5 | | 0.1 ppm | 50 |

Well Construction

STATE ENGINEER'S OFFICE
2006 OCT 22 AM 10:13
RECEIVED

Log # 119680 pg 3 of 3
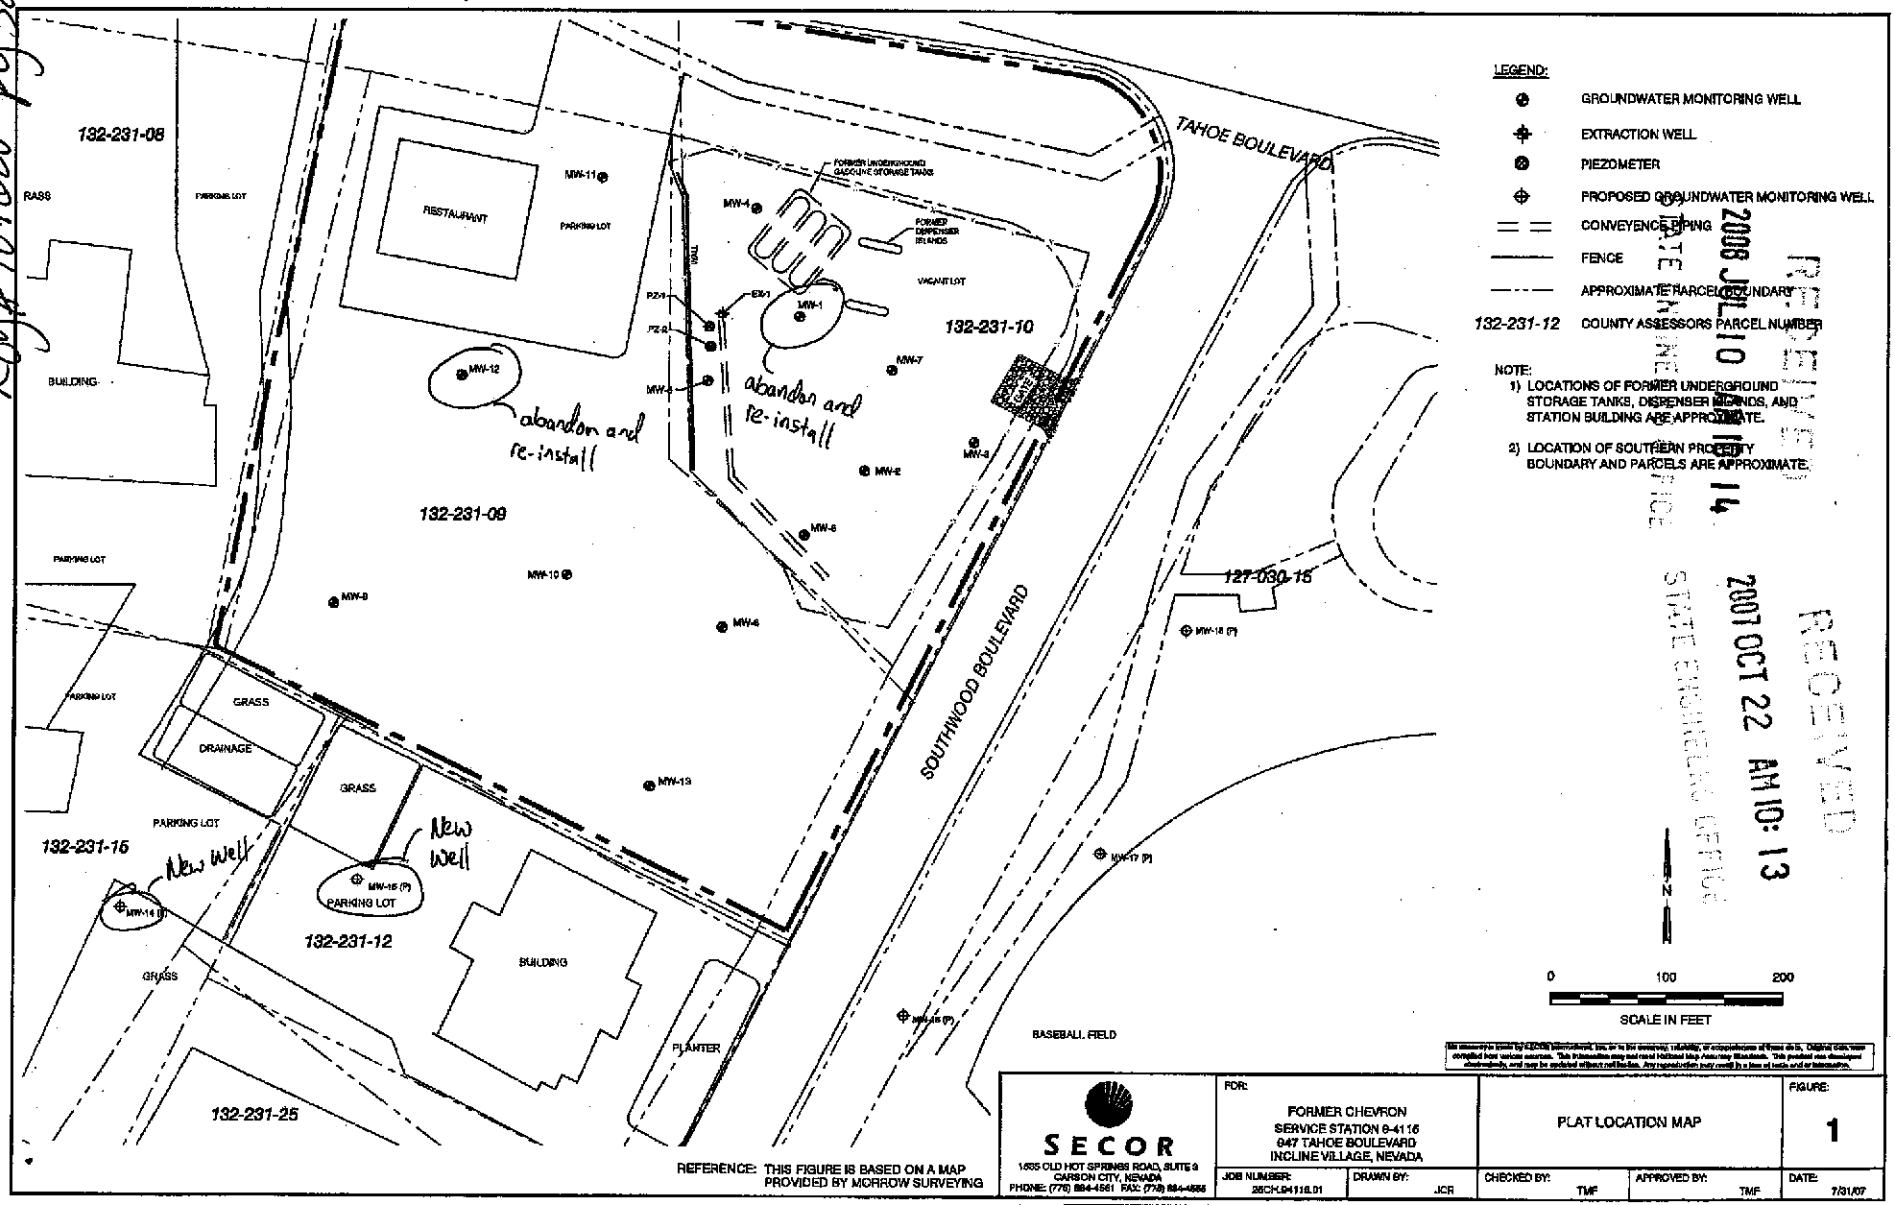
MW-12 Abandonment