



Layne Christensen Co.

1717 W Park Ave.
Redlands, CA. 92373
Phone: (909) 390-2833
CA Lic.#: 510011

Well Inspection Report

CLIENT: Virgin Valley Water District
 ADDRESS: _____
 CONTACT: Aaron Bunker PHONE: 435-862-8379
 JOB LOCATION: 156 N. 2nd West St. Bunkerville, NV
 GPS LOCATION: Latitude: N 36° 46.431' Longitude: W 114° 07.776'

WELL NUMBER: 2 Post liner JOB NUMBER: 30148

SURVEYED BY: Jose Rocha DATE: 5-Jun-14

REVIEWED BY: WATER LEVEL: 19.8'





WATER CONDITION: Clear TOTAL DEPTH: Unknown

CASING DIAMETER: 10.25" ID SURVEY DEPTH: 640.2'

*All Depths Shown are relative to the center of the side camera perspective.

DEPTH	REMARKS
	Video was started at top of liner. 13" under pre liner.
0 - 411.5'	Liner appears to be in normal condition and intact.
412 - 443'	Perforations appear to have mild to moderate scale and growth.
443 - 468'	Casing appears to have heavy scale and growth.
468 - 540'	Perforations appear to have mild to moderate scale and growth.
540 - 560'	Casing appears to have heavy scale and growth.
560 - 628'	Perforations appear to have mild to moderate scale and growth.
628 - 640'	Perforations appear to have moderate to heavy scale and growth.
640.2'	Camera come to rest on top of fill.

0 - 411.5'	412 - 443'
443 - 468'	468 - 540'
540 - 560'	560 - 628'
628 - 640'	

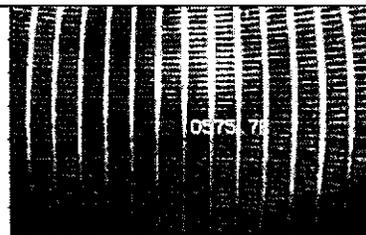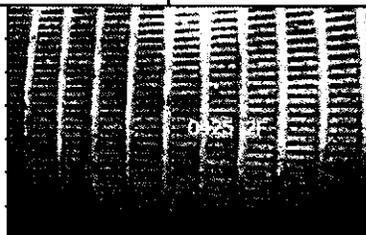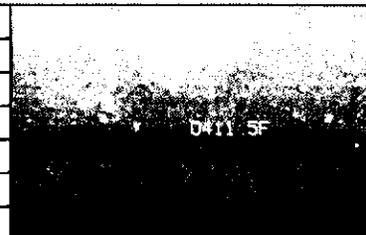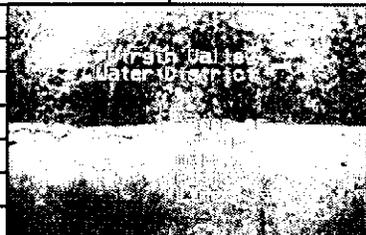

DGNR/DWR/SNBO
RECEIVED
JUN 26 2014