

STATE OF NEVADA
DIVISION OF WATER RESOURCES
WELL DRILLER'S PLUGGING REPORT

OFFICE USE ONLY
Log No. 123335
Permit No. AA-UW-6
Basin

PRINT OR TYPE ONLY
DO NOT WRITE ON BACK

Please complete this form in its entirety in
accordance with NRS 534.170 and NAC 534.340

NOTICE OF INTENT NO. 39475
WELL NAME (if applicable) AA-UW-6

1 OWNER Greystone Nevada LLC
MAILING ADDRESS 2490 Paseo Verde Pkwy #120
Henderson, NV 89074

ADDRESS AT WELL LOCATION Private Right of Way
Subdivision Name County Clark

2 LOCATION SW 1/4 NE 1/4 Sec 5 T 22S N/S R 63 E
PERMIT/WAIVER No 179-05-695-003
Issued by Water Resources Parcel No

Latitude 36.064140 UTM E NAD 27
Longitude -114.963114 N NAD 83/WGS 8

3 TYPE OF WELL
 Domestic Irrigation Test
 Municipal/Industrial Monitor Stock

Is this well being plugged because a replacement well was drilled? no
If yes, what is replacement well NO?
Is there an existing well log?
If yes, what is NDWR well log #?

4 EXISTING WELL CONSTRUCTION

Depth Drilled	Feet	Depth Cased	66	Feet
---------------	------	-------------	----	------

EXISTING CASING SCHEDULE

Size O.D. (Inches)	Weight/Ft. (Pounds)	Wall Thickness (Inches)	From (Feet)	To (Feet)
4	PVC	SCH 40	0	66

7 WELL PLUGGING PROCEDURE
Was well cleaned out to total depth? yes no
If well was not cleaned out to total depth, please explain why:
Was the well contaminated? yes no
Was the casing pulled? yes no if pulled from: 12 feet to 0 feet
Was the casing over drilled? yes no

Existing Perforations:

Type of perforation	Size of perforation	feet to	feet
MACHINE SLOTTED	0.02		

If casing was left in place, please show where additional perforations were made:
Additional Perforations:
Type of perforator used:
From feet to feet Number of perfs per linear foot

5 WATER LEVEL
Static water level 56 feet below land surface
Artesian flow G.P.M. P.S.I.
Water temperature 76 °F Quality

6 Additional Notes or Comments

From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot
From feet to feet Number of perfs per linear foot

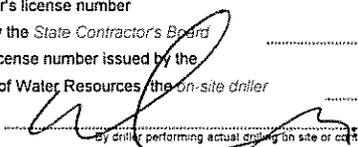
CASING BROKE OFF AT 12 FT BELOW GROUND SURFACE. KNOCKED OUT BOTTOM. AND GROUTED FROM BOTTOM TO TOP WITH TREMIE

8 WELL PLUGGING MATERIALS
Material Used
From 66 feet to 0 feet BENTONITE GROUT Pumped Poured
From feet to feet Pumped Poured

Neat Cement Fluid Weight lbs/gal
Bentonite Grout 28 % bentonite
Date Started 9/3/2015
Date Completed 9/3/2015

9 DRILLER'S CERTIFICATION
This well was plugged and abandoned under my supervision and the report is true to the best of my knowledge.
Name EAGLE DRILLING SERVICES, LLC.
Address 7150 PLACID ST LAS VEGAS, NV 89119

DCNR/DWR/SNBO
RECEIVED
SEP 11 2015

Nevada contractor's license number issued by the State Contractor's Board 51266
Nevada driller's license number issued by the Division of Water Resources the on-site driller 2490-LTD
Signed 
By driller performing actual drilling on site or contractor

Date 9/8/2015

36.0641637
-114.9622882
NAD
27