

PRINT OR TYPE ONLY
 DO NOT WRITE ON BACK

WELL DRILLER'S REPORT

Please complete this form in its entirety in accordance with NRS 534.170 and NAC 534.340

NOTICE OF INTENT NO. 18140

1. OWNER Jim Slade ADDRESS AT WELL LOCATION 5201 S. Sunland Ave
 MAILING ADDRESS 5201 S. Sunland Ave. 5201 S. Sunland Ave
Pahrump, NV 89048

2. LOCATION NW 1/4 NW 1/4 Sec. 8 T 21S N/S R 54E E Nye County
 PERMIT NO. 45-111-11 Sunland Estates Subdivision Name
 Issued by Water Resources Parcel No.

3. WORK PERFORMED 4. PROPOSED USE 5. WELL TYPE

New Well Replace Recondition Domestic Irrigation Test Cable Rotary RVC
 Deepen Abandon Other Municipal/Industrial Monitor Stock Air Other

6. LITHOLOGIC LOG

Material	Water Strata	From	To	Thick-ness
brown sandy loam		0	15	15
brown calache		15	27	12
brown calache		27	62	35
brown calache	x	62	80	18
See next line	x	80	103	23
grey loam with calache strings				
brown sandy loam	x	103	126	23
brown calache	x	126	140	14

8. WELL CONSTRUCTION

Depth Drilled 140 Feet Depth Cased 140 Feet

HOLE DIAMETER (BIT SIZE)

From	To
<u>11</u> Inches	<u>0</u> Feet <u>140</u> Feet
_____ Inches	_____ Feet _____ Feet
_____ Inches	_____ Feet _____ Feet

CASING SCHEDULE

Size O.D. (Inches)	Weight/Ft. (Pounds)	Wall Thickness (Inches)	From (Feet)	To (Feet)
<u>6 5/8</u>	<u>3.7</u>	<u>.280</u>	<u>0</u>	<u>140</u>

Perforations:

Type perforation sawcut
 Size perforation .188


From	feet to	feet
<u>110</u>	<u>140</u>	_____
_____	_____	_____
_____	_____	_____
_____	_____	_____
_____	_____	_____

Surface Seal: Yes No Seal Type: Neat Cement
 Cement Grout
 Concrete Grout

Depth of Seal 50

Placement Method: Pumped Poured

Gravel Packed: Yes No
 From 50 feet to 140 feet

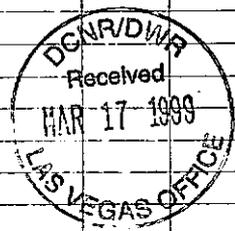

Date started 3/9/99 _____ 19
 Date completed 3/9/99 _____ 19

7. WELL TEST DATA

TEST METHOD:	Draw Down (Feet Below Static)	Time (Hours)
<input type="checkbox"/> Bailer <input type="checkbox"/> Pump <input checked="" type="checkbox"/> Air Lift		
G.P.M. <u>.5</u>	<u>na</u>	<u>.50</u>

9. WATER LEVEL

Static water level 62 feet below land surface
 Artesian flow _____ G.P.M. _____ P.S.I.
 Water temperature cold °F Quality good

10. DRILLER'S CERTIFICATION

This well was drilled under my supervision and the report is true to the best of my knowledge.

Name Strickland Construction Co., Inc. Contractor
 Address 2301 Winery Road, Suite 2 Contractor
Pahrump, NV 89048

Nevada contractor's license number issued by the State Contractor's Board 40277

Nevada driller's license number issued by the Division of Water Resources, the on-site driller 2086

Signed [Signature]
 By driller performing actual drilling on-site or contractor

Date 3.10.99

