Basin #104 Log# 85740

NW¼NE¼ Section 20, T15N, R. 20E. Permit # 54119

Carson City, Cnty.

LOG OF BORING RW10

Equipment 12" Hollowstem Auger

Elevation _____ Date 1/12/90

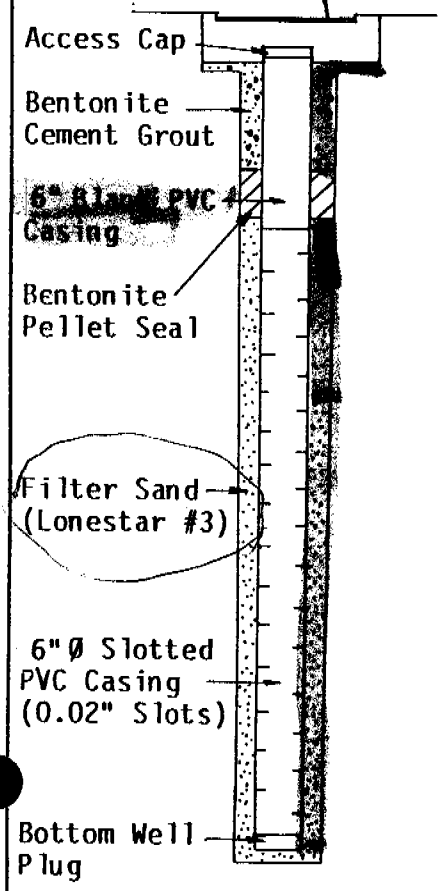

HC Odor	TIP reading (ppm)	Depth (ft)	Sample	
		0		DARK BROWN SANDY SILT (ML) Stiff, moist
				GRAY POORLY GRADED SAND (SP) Dense, moist to saturated
No	0	5		Color change to orange
				DARK GRAY SILTY SAND (SM) Medium dense, saturated
No	0	10		GREEN-GRAY SANDY SILT (ML) Stiff, saturated
				GRAY POORLY GRADED SAND (SP) Medium dense, saturated
No	0	15		
				GRAY SANDY SILT (ML) Stiff, saturated
No	0	20		GREEN LEAN SILT (ML) Very stiff, "dry feeling"
				Boring terminated at 21.50 feet Groundwater encountered at 3.9 feet at time of drilling Boring converted to Recovery Well RW10 on 1/12/90
		25		
		30		
		35		
		40		

Harding Lawson Associates
Engineers, Geologists & Geophysicists

LOG OF BORING RW10
MALLORY INCORPORATED
CARSON CITY, NEVADA

PLATE

DLN # 1028 (Andresen)

DRAWN	JOB NUMBER	APPROVED	DATE	REVISED	DATE
MAE	18,531,001.05		2/28/90		