[redacted]

Log# 85742

Permit# 54415

[redacted] 1/4 NE 1/4 Section 20, T.15N., R.20E

Carson City, [redacted]

LOG OF BORING RW6

Equipment 12" Hollowstem Auger

Elevation _____ Date 1/9/90

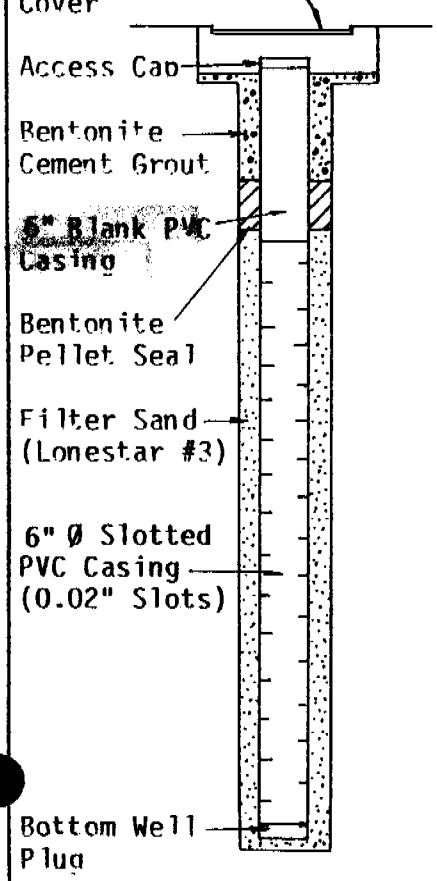

HC Odor	TIP reading (ppm)	Depth (ft)	Sample	Description
		0		DARK BROWN SANDY SILT (ML) Stiff, dry to moist
No	0	5		LIGHT BROWN POORLY GRADED SAND WITH SILT (SP) Medium dense, moist
				ORANGE-BROWN SANDY SILT (ML) Very stiff, mottling, saturated
No	0.2	10		Color change to green GRAY POORLY GRADED SAND WITH SILT AND GRAVEL (SP) Dense, saturated
No	0.1	15		GREEN BROWN SANDY SILT (ML) Stiff, saturated
No	0.1	20		GREEN-GRAY SILT (ML) Stiff, "dry feeling", trace sand
				Boring terminated at 21.5 feet
				Groundwater encountered at 6.8 feet at time of drilling
				Converted to Recovery Well RW6 on 1/9/90
		25		
		30		
		35		
		40		

Harding Lawson Associates
Engineers, Geologists & Geophysicists

LOG OF BORING RW6
MALLORY INCORPORATED
CARSON CITY, NEVADA

PLATE

DLN 1028 (Andresen)

DRAWN	JOB NUMBER	APPROVED	DATE	REVISED	DATE
MAE	18,531,001.05	[illegible]	2/28/90		