



Lahontan GeoScience, Inc.

Well Abandonment Log


39.687066N 118.089719W NAD27

Project: Water Well Closures in Dixie Valley

Project No.: NASF: 03140
Sheet 1 of 1


Contract No:

Boring No.: 081D

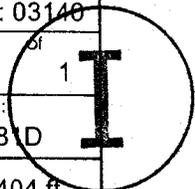

Location (TRS): T. 21N, R. 35E, Sec. 24, ^{18 NE} NW 1/4, ^{SW} SE 1/4		Location (Lat/Lon): 39° 41.219' N, 118° 5.441' W ^{NAD 83}		Elevation: 3404 ft	
Permit No.: none	Well Log: none	Measured Depth: 135 ft	Perf. Date: -		
Borehole Dia.: unknown	Casing Size: 3", steel	Measured Casing Size: 3", steel	Plug Date: 11/20/03		
Borehole Depth: unknown	Casing Depth: unknown	Static Water Level: Flowing	Supervised by: J. R. Humphrey		
Perforations at time of construction: unknown		Additional Perforations: None	Driller: W. E. Knoblock		

Depth (feet)	Lithology	Detail	Well Construction	
	*Recorded at time of drilling		*Recorded at time of drilling	Abandonment
0	No well log available			<p>Well flowing at surface</p> <p>2" inner pipe of unknown depth</p> <p>Casing break at about 10 ft bgs causing flow to surface from outside casing</p> <p>Plug date: 11/20/03 vol. of cement = 2.0 cu. yds nominal density = 18.6 lbs./gal.</p> <p>Waiver No. R-454</p> <p>Measured Depth = 135 ft</p>
50				
100				

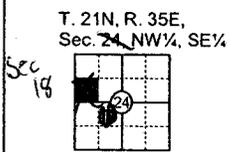

rel 1-22-06
RC 1-4-07