

**STATE OF NEVADA  
DIVISION OF WATER RESOURCES  
WELL DRILLER'S PLUGGING REPORT**

OFFICE USE ONLY  
Log No. **106838**  
Permit No. \_\_\_\_\_  
Basin **212**

**PRINT OR TYPE ONLY  
DO NOT WRITE ON BACK**

*Please complete this form in its entirety in  
accordance with NRS 534.170 and NAC 534.340*

**4679** NOTICE OF INTENT NO. **34093**

1 OWNER **Inspirado Apts, LLC**  
MAILING ADDRESS **53.65 S. Cameron , Las Vegas, NV 89118**

ADDRESS AT WELL LOCATION **4743 Balsam St**  
**Las Vegas, NV**

Subdivision Name: \_\_\_\_\_ County: **Clark**

2 LOCATION **NE 1/4 NE 1/4 Sec 3 T 20S N/S R 60 E**  
PERMIT/WAIVER No. **N/A** **138-03-510-025**  
Issued by Water Resources Parcel No. **910**

Latitude **N36 14' 48.6"** UTM E  NAD 27  
Longitude **W115 14' 42.5"** N  NAD 83/WGS 84

3 TYPE OF WELL  
 Domestic  Irrigation  Test  
 Municipal/Industrial  Monitor  Stock

Is this well being plugged because a replacement well was drilled? **No**  
Is there an existing well log? **Yes**  
If yes, what is replacement well NOI? \_\_\_\_\_  
If yes, what is NDWR well log #? **53403**

4 EXISTING WELL CONSTRUCTION  
Depth Drilled **350** Feet Depth Cased **350** Feet

7 WELL PLUGGING PROCEDURE  
Was well cleaned out to total depth?  yes  no  
If well was not cleaned out to total depth, please explain why: \_\_\_\_\_

EXISTING CASING SCHEDULE				
Size O.D. (Inches)	Weight/Ft. (Pounds)	Wall Thickness (Inches)	From (Feet)	To (Feet)
8 5/8	12	.141	0	350

Was the well contaminated?  yes  no  
Was the casing pulled?  yes  no  
Was the casing over drilled?  yes  no

Existing Perforations:

Type of perforation	Size of perforation	Factory unknown
From	290 feet to	350 feet
From	_____ feet to	_____ feet
From	_____ feet to	_____ feet
From	_____ feet to	_____ feet
From	_____ feet to	_____ feet

Additional Perforations:

Type of perforator used:	Number of perfs per linear foot
From <b>350</b> feet to <b>50</b> feet	<b>2</b> rows
From _____ feet to _____ feet	_____
From _____ feet to _____ feet	_____
From _____ feet to _____ feet	_____
From _____ feet to _____ feet	_____
From _____ feet to _____ feet	_____

5 WATER LEVEL  
Static water level **130** feet below land surface  
Artesian flow \_\_\_\_\_ G.P.M. \_\_\_\_\_ P.S.I.  
Water temperature \_\_\_\_\_ ° F Quality \_\_\_\_\_

8 WELL PLUGGING MATERIALS


Material Used	Quantity
From <b>350</b> feet to <b>25</b> feet neat cement	<input checked="" type="checkbox"/> Pumped <input type="checkbox"/> Poured
From <b>25</b> feet to <b>0</b> feet 3/8 Grout	<input type="checkbox"/> Pumped <input checked="" type="checkbox"/> Poured
From _____ feet to _____ feet	<input type="checkbox"/> Pumped <input type="checkbox"/> Poured
From _____ feet to _____ feet	<input type="checkbox"/> Pumped <input type="checkbox"/> Poured
From _____ feet to _____ feet	<input type="checkbox"/> Pumped <input type="checkbox"/> Poured
From _____ feet to _____ feet	<input type="checkbox"/> Pumped <input type="checkbox"/> Poured

6 Additional Notes or Comments  
**From 25' to 350' there was a six inch liner, perforated from 350' up to 50'**

Neat Cement Fluid Weight **24** sack lbs/gal  
Bentonite Grout \_\_\_\_\_ % bentonite  
Date Started **9/26/2008**  
Date Completed **109/30/2008**

9 DRILLER'S CERTIFICATION  
This well was plugged and abandoned under my supervision and the report is true to the best of my knowledge.  
Name **Redding Drilling & Pump Service**  
Address **530 E Larson Lane**  
**Henderson, NV 89044**  
Nevada contractor's license number issued by the State Contractor's Board **38155**  
Nevada driller's license number issued by the Division of Water Resources, the on-site driller **2063**

Signed **Ra. Towle**  
By driller performing actual drilling on site or contractor  
Date **10/1/2008**

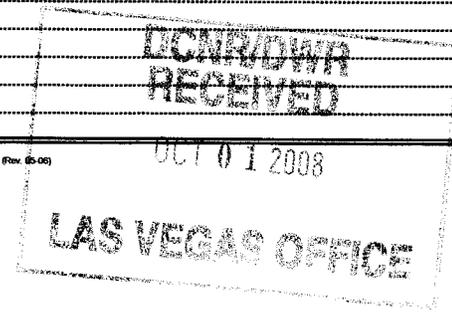

USE ADDITIONAL SHEETS IF NECESSARY

(Rev. 6-05)